

Metal pipes Through Slab

APPLICATION:

**CP638:** MP-RF-M-04

## **INFORMATION:**

- Not to scale
- All units are in millimetres
- Tested according EN 1366-3
- Classification Report 23003B

CP 638 Mortar + CFS-S ACR

DATE:


02

ID:

05/2025

Fire Rating up to El 120


Page 3/3

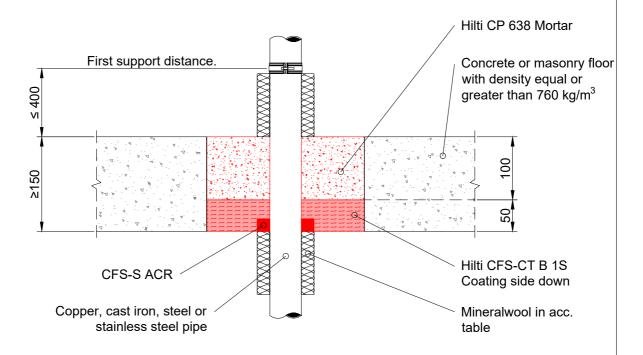

## Notes:

1. All gaps around services and coated board edges filled with Hilti Firestop Acrylic Sealant CFS-S ACR

Metal pipes with local interrupted insulation Rockwool Roclap H&V Section						
Material	Diameter	Min. wall thickness	Localy Interrupted: Rockwool Roclap Thickness	Length on both sides of the floor	Fire rating in mixed opening	
Copper, cast iron, steel, stainless steel.	≤ 28	0.9	40	≥ 800	EI 120-C/U	
Copper, cast iron, steel, stainless steel.	≤ 54	1.2	40	≥ 800	EI 120-C/U	
Copper, cast iron, steel, stainless steel.	≤ 108	1.5	40	≥ 800	EI 120-C/U	
Cast iron, steel, stainless steel.	≤ 165	5	40	≥ 800	EI 120-C/U	

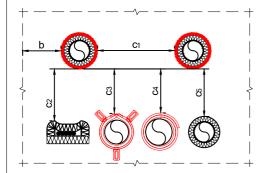

Spacing overview for mixed seals					
Description	Shortcut	Distance			
To seal edge	b	≥ 50 mm			
To other pipes with CFS-S ACR	C <sub>1</sub>	≥ 38 mm			
To cables with CFS-IS	c <sub>2</sub>	0 mm			
To other services with CFS-C EL	c <sub>3</sub>	0 mm			
To other services with CFS-B	C <sub>4</sub>	0 mm			
To any other services	C <sub>5</sub>	≥ 100 mm			

Maximum opening size without additional support: 2000 x 1800 mm or reduced width, with up-to 10m length. See classification report for further details.

Hilti (Gt. Britain) Limited | No 1, Circle Square | 3 Symphony Park | Manchester | M1 7FS

Freephone: 0800 886 100 | Website: www.hilti.co.uk

<sup>1.</sup> The application limits on this detail are for guidance purposes only. For more detailed information based on the full range of available test results please contact the Hilti Technical Advisory Service.

2. The product and application has been assessed as a minimum to the BS 476 standard. It may have additional European and worldwide testing. Please contact Hilti for further information.

3. All installations should be carried out in accordance with Hilti's installation instructions and by competent & experienced installers using Hilti branded products.

4. All services are to be correctly and adequately supported to prevent collapse and distortion.